

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave.St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-017400**Date Inspected:** 07-Oct-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai,China**CWI Name:** Mr.Xu Tao/Li Yan Hua**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

On this date Caltrans OSM Quality Assurance (QA) Inspector, Nagalingam Pandaram Pillai was present during the times noted above for observations relative to the work being performed.

In process Inspection

Bay #19

This QA inspector observed the following work in progress:

FCAW welding of weld joint no: SB020-090-004 located on OBG Suspender Bracket SB 090E. Welder is identified as #062749. ABF QA is identified as Mr. Peng Wei Jun. Welding was performed according to the Critical weld repair report B-CWR 2010 and MT report number: B787-MT-30232.The welding variables recorded by QC appeared to comply with the WPS-345-FCAW-2G(2F)-Repair. Please see the attached picture.

This QA Inspector observed the following work in progress:

FCAW in the 1G position for the OBG Bike Path, weld No: BK004A2-009-016. The welder is identified as #062734. ZPMC QC is identified as Mr.Liu Dao Feng. The welding variables recorded by QC appear to comply with WPS-B-T-2231-B-L1B-F-1.

This QA Inspector observed the following work in progress:

FCAW in the 1G position for the OBG Bike Path, weld No: BK004A2-007-018. The welder is identified as #062755. ZPMC QC is identified as Mr.Liu Dao Feng. The welding variables recorded by QC appear to comply

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

with WPS-B-T-2231-B-L1B-F-1.

This QA Inspector observed the following work in progress:

FCAW in the 3G position for the OBG Bike Path, weld No: BK005A8-001-002. The welder is identified as #062808. ZPMC QC is identified as Mr.Liu Dao Feng. The welding variables recorded by QC appear to comply with WPS-B-T-2233-TC-P4-F.

OUTSIDE YARD

This QA inspector observed the following work in progress:

FCAW welding of weld joint no: SEG3003S-056 located on OBG Segment 12CE Longitudinal Diaphragm. Welder is identified as #068501. ZPMC CWI is identified as Mr. Li Yan Hua. Welding was performed according to the Critical weld repair report B-CWR 1420 and MT report number: B787-UT-12371R1. The welding variables recorded by QC appeared to comply with the WPS-345-FCAW-2G(2F)-Repair. Please see the attached picture.



This QA Inspector observed the following work in progress:

SMAW in the 4F position for the OBG Segment 12CE, Weld No: OBE12C-004/005. The welder is identified as #043661. ZPMC QC is identified as Mr.Wang Xiang Pin. The welding variables recorded by QC appear to comply with WPS-B-P-2114-FCM-1.

This QA Inspector observed the following work in progress:

FCAW in the 2G position for the OBG Segment 12CE, Weld No: SEG3003M-021. The welder is identified as #049339. ZPMC QC is identified as Mr.Wang Xiang Pin. The welding variables recorded by QC appear to comply with WPS-B-T-2232-TC-U4B-F-1.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

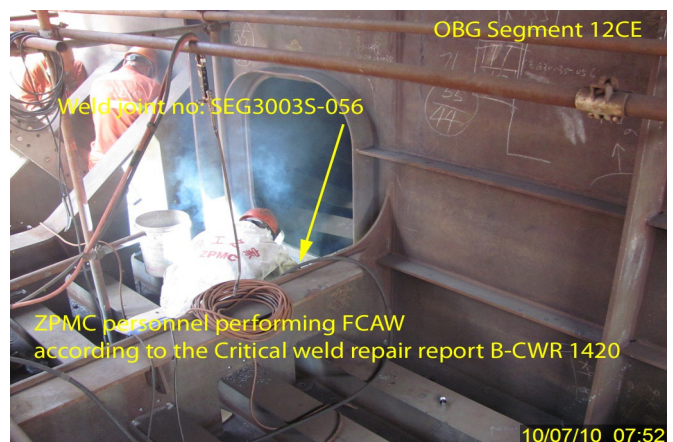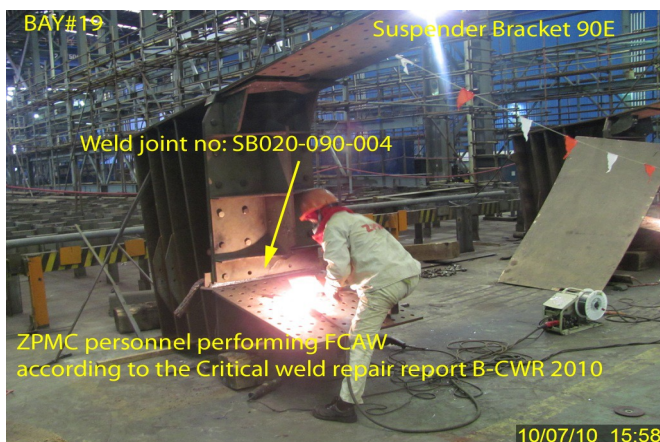

Summary of Conversations:

No Relevant Conversation.

Comments

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang 150-0042-2372, who represents the Office of Structural Materials for your project.

Inspected By:	Pillai,Pandaram	Quality Assurance Inspector
Reviewed By:	McClendon,Timothy	QA Reviewer
